Installation Instructions – EXM-BNC




Cut cable squarely.

4



tool in good condition, prepare cable to 1/4" x 1/4" dimensions. Use edge of tool if no stop

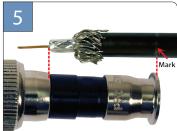

Align the cable with the connector and mark the cable jacket for proper installation depth as shown above.



Using your VT-HE compression tool, make sure the rotating compression head is positioned for BNC as shown in the picture. Properly seat connector and compress fully.



Fold back braid. If Trishield or Quadshield remove additional foil layer and fold back remaining braid.



Insert the cable into the back of the connector and into the floating pin. Push the connector on while rotating until fully seated.



Install BNC into port.



Part Number Description EXM-BNC EX Mini Series, BNC Connector






VT-HE







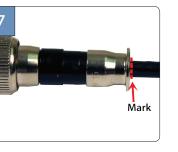

correct. Use gauge on VT tool

to check the center conductor

length.

The cable mark from step 5 should line up with the back edge of the compression ring.