

Technical Bulletin

Z9TV-B Chassis Power Supply Capacitor Replacement (CP01)

This Technical Bulletin explains the replacement of a capacitor on the Z9TV-B Chassis.



Communication
Systems, Inc.
40 Greenwood Lane
Springboro, Ohio
45066

PH: 937-743-6010
FX: 937-743-5664

<http://www.pdiarm.com>

CP01 Replacement Instructions

Better Solutions Are Within Reach®

Background

In early versions of the Z9TV-B chassis power supply, capacitor CP01 may fail under conditions where the incoming voltage is higher than normal.

Corrective Action

1. Examine the value of electrolytic capacitor CP01 (located near fuse FP01).
2. If CP01 is rated 15 V or less. Replace with a higher voltage rated capacitor of at least 25V.

NOTE: All sets returned to PDI have this capacitor replaced as a precaution with a 35v rated capacitor.

For More Information

If you have questions, please contact PDI's Engineering department at 937-743-6010 Extension 252.