



SUBJECT: Replacement of Top or Overhead Vent Scoop, Part No. 640138

MODELS AFFECTED: M20C, S/N 3185-3288 (1966)
M20E, S/N 832-955 (1966)

TIME OF COMPLIANCE: Optional

INTRODUCTION: Reported difficulty in closing off the air flow from the overhead air scoop may be remedied by replacing the overhead vent scoop with one having a slightly longer leading edge.

INSTRUCTIONS:

1. Remove the overhead vent scoop (Part No. 640138) located at the top of the cabin area by pulling the hinge pin and disconnect the control attachment to the scoop.
2. Install the new overhead vent scoop (Part No. 640138) which is .25 inches longer at the leading edge by reinserting and securing the hinge pin and reconnecting the cabin control attachment at the scoop. Trim or form the leading edge as required for a tight fit with the scoop closed.
3. Check the scoop and control for proper security and operation.

SERVICE LETTER KIT NO. 20-135:

PARTS LIST

Painted overhead vent scoop .25 inches longer (Part No. 640138)

These kits may be ordered from your local Mooney distributor.
Direct factory orders will not be accepted.