

MOONEY AIRCRAFT, INC.

Service Letter 20-30

DATE: : 3-13-58
SUBJECT: Inspection - Tail Truss
MODELS AFFECTED: M20 & M20A Serial No. 1002 - 1210
TIME OF COMPLIANCE: Immediately

Due to the possibility of cracks at the welded joint between P/N 4007 bracket and P/N 4047 Gusset (4 Places on P/N 4009 Tail Truss) the following inspection is necessary. (See Fig. 1)

- (1) Remove the fairing between Horizontal Stabilizer and Fuselage.
- (2) Remove Paint at Welded Joints.
- (3) Carefully inspect for cracks on both right and left sides of Tail Truss areas shown in Fig. 1.
- (4) Complete and return enclosed compliance card.

If cracks exist replace P/N 4009 Tail Truss.

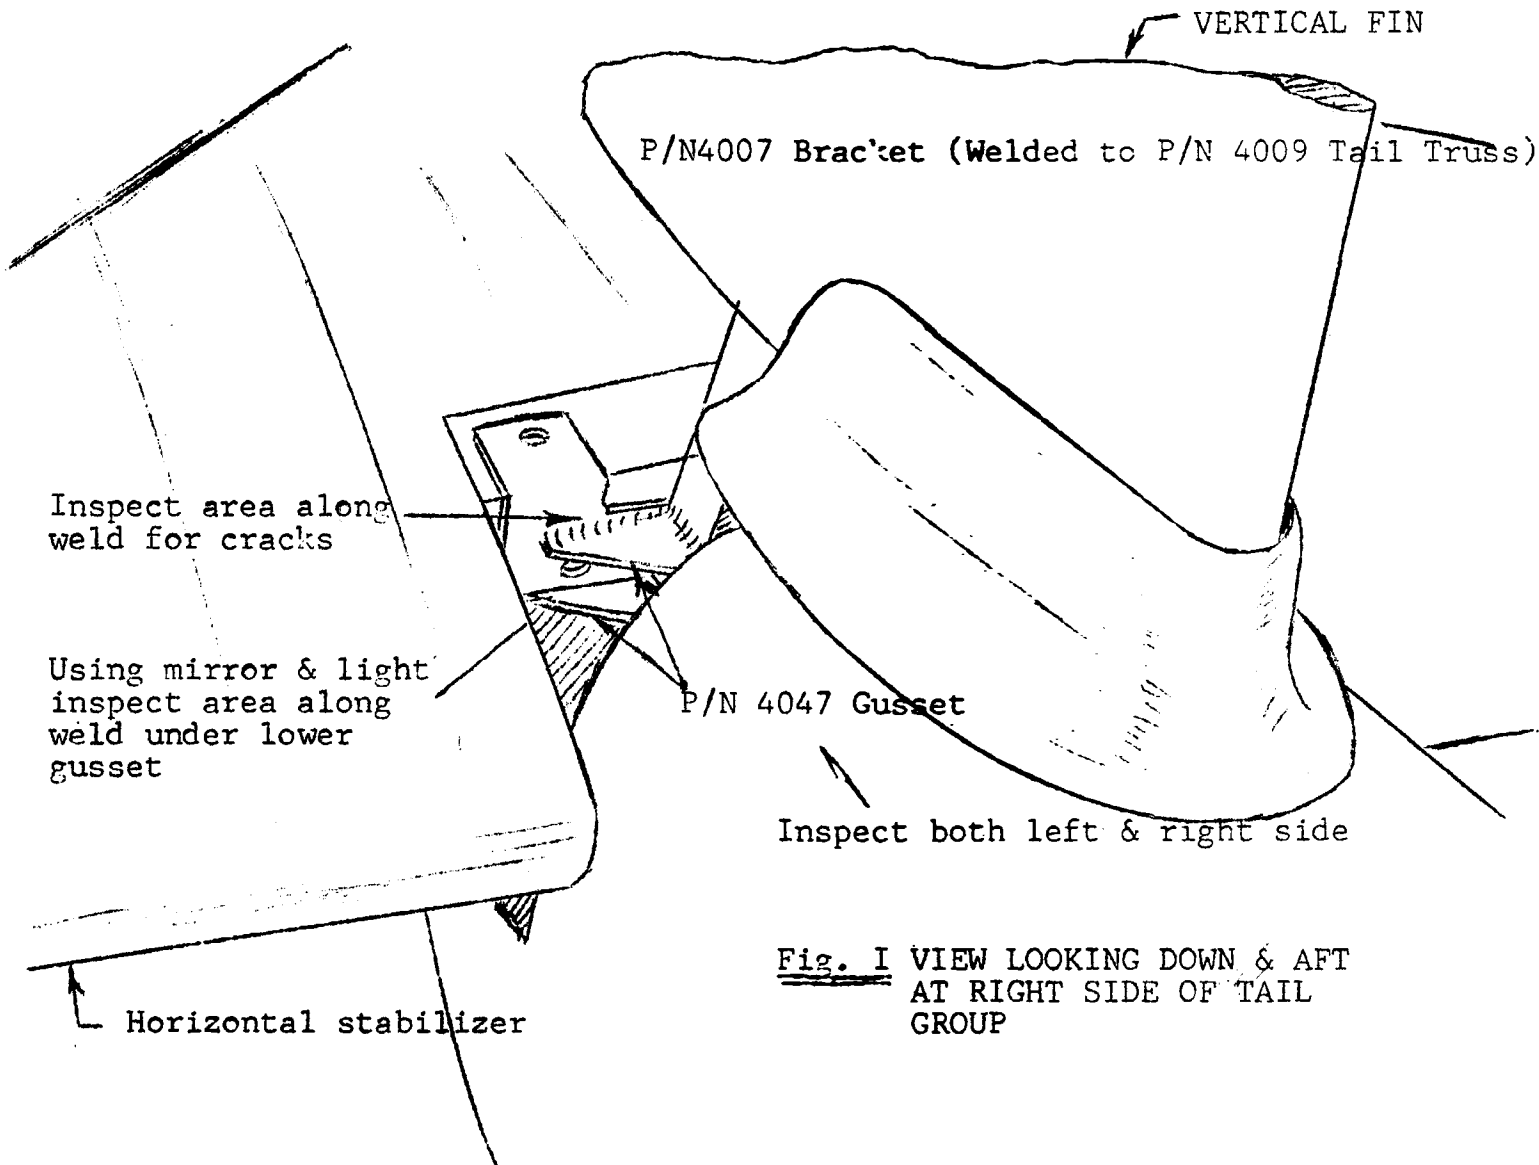


Fig. 1 VIEW LOOKING DOWN & AFT
AT RIGHT SIDE OF TAIL
GROUP