

MODEL NUMBER:

PDI-AA1007 Series Arm

Document Number: PD196-246R1

Installation Instruction for 1007 Series Arm

Page 1 of 10



RISK OF ELECTRIC SHOCK. DO NOT OPEN! CAUTION: TO REDUCE THE RISK OF ELECTRIC SHOCK, DO NOT





This symbol indicates that dangerous voltage constituting a risk of electric shock is present within this unit.



This symbol indicates that there are important operating and maintenance instructions in the literature accompanying this unit.

REMOVE COVER. NO USER SERVICEABLE PARTS INSIDE. REFER SERVICING TO QUALIFIED SERVICE PERSONNEL

THIS INSTALLATION SHOULD BE MADE BY A QUALIFIED SERVICE PERSON AND SHOULD CONFORM TO ALL LOCAL CODES. READ ANDFOLLOW THE SAFETY INSTRUCTIONS BEFORE ATTEMPTING THIS INSTALLATION.

NOTE to CATV system installer: This reminder is provided to call the CATV system installer's attention to Article 820-40 of the NEC that provides guidelines for proper grounding and, in particular, specifies that the cable ground shall be connected to the grounding system of the building, as close to the point of cable entry as practical.



WARNING: OXYGEN ENVIRONMENT DO

NOT use in an oxygen tent or oxygen chamber. Such use may cause a fire hazard.



WARNING: To avoid the hazards of fire or electric shock, DO NOT expose this TV to rain or moisture.



DANGER: ARM RECOIL HAZARD The safety brake pin must remain in the SAFETY BRAKE PIN HOLE whenever the television set is removed from the arm or when the arm is removed from the wall bracket to prevent the arm from springing open.

Apparatus shall not be exposed to dripping or splashing and no objects filled with liquids, such as vases, shall be placed on the apparatus. Unplug this unit from the wall outlet before cleaning. Do not use liquid cleaners or aerosol cleaners. Use a damp cloth for cleaning. This unit REQUIRES periodic maintenance. Refer to the maintenance section for instructions.

- 1. Read these instructions.
- 2. Keep these instructions.
- 3. Heed all warnings.
- 4. Follow all instructions.
- 5. Do not use this apparatus near water.
- 6. Clean only with dry cloth.
- 7. Do no block any ventilation openings. Install in accordance with the manufacturer's instructions.
- 8. Do not install near any heat source such as radiators, heat registers, stove, or other apparatus (including amplifiers) that produce heat.
- 9. Use only with the cart, stand, tripod, bracket or table specified by the manufacturer, or sold with the apparatus. When a cart is used, use caution when moving the cart/apparatus combination to avoid injury from tip-over.



10. Do not defeat the safety purpose of the polarized or grounding-type plug. A polarized plug has two blades

with one wider than the other. A grounding type plug has two blades and a third grounding prong. The wide blade or the third prongs are provided for your safety. If the provided plug does not fit into your outlet, consult an electrician for replacement of the obsolete outlet.

- 11. Protect the power cord from being walked on or pinched particularly at plugs, convenience receptacles, and the point where they exit from the apparatus.
- 12. Only use attachments/accessories specified by the manufacturer.
- 13. Unplug this apparatus during lightning storms or when unused for long periods of time.
- 14. Refer all servicing to qualified service personnel. Servicing is required when the apparatus has been damaged in any way, such as power-supply cord or plug is damaged, liquid has been spilled or objects have fallen into the apparatus, the apparatus has been exposed to rain or moisture, does not operate normally, or has been dropped.

Contact PDi for complete list of approved TV model numbers for which this arm can be used.



MODEL NUMBER:

PDI-AA1007 Series Arm

PD196-246R1

Document Number:

Page 2 of 10

Installation Instruction for 1007 Series Arm

Scope:

How to install a 1000 series PDI arm into a PDI-180C wall bracket.

Tool List:

- 1) Safety glasses/goggles
- 2) P1 OR P2 Phillips screw driver
- 3) Medium size pair of needle nose pliers
- 4) 5/32 Hex key or hex bit and driver
- 5) pliers

Safety Steps:


- 1) Always wear safety glasses/goggles to prevent injury from debris.
- 2) Follow the installation/removal instructions for your existing products.

Procedure:

Step 1:

Remove the PDIPFHMS103238 screw from the PD216-006 base pin cover and set aside for re-installing later. Remove the PD216-006 basepin cover from the top of the wall bracket.

Remove the PDI-609 basepin from the wall bracket.

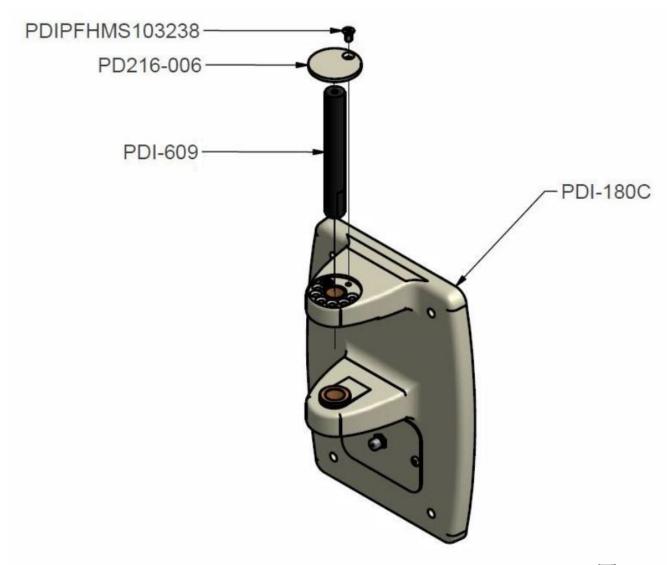



MODEL NUMBER.		
PDI-AA1007	Series	Arm

Installation Instruction for 1007 Series Arm

Page 3 of 10


Step 2:

Place the base of the arm into the clevis of the wall bracket and align the 5/8" holes of the arm base with the holes of the wall bracket bushings.

Insert the PDI-609 base pin (end with flats first) thru the top bushing the arm base and the lower bushing.

The flats on the base pin must be properly aligned with the Double "D" plate in the bottom of the base for proper installation.

This will be shown in more detail on the following page.

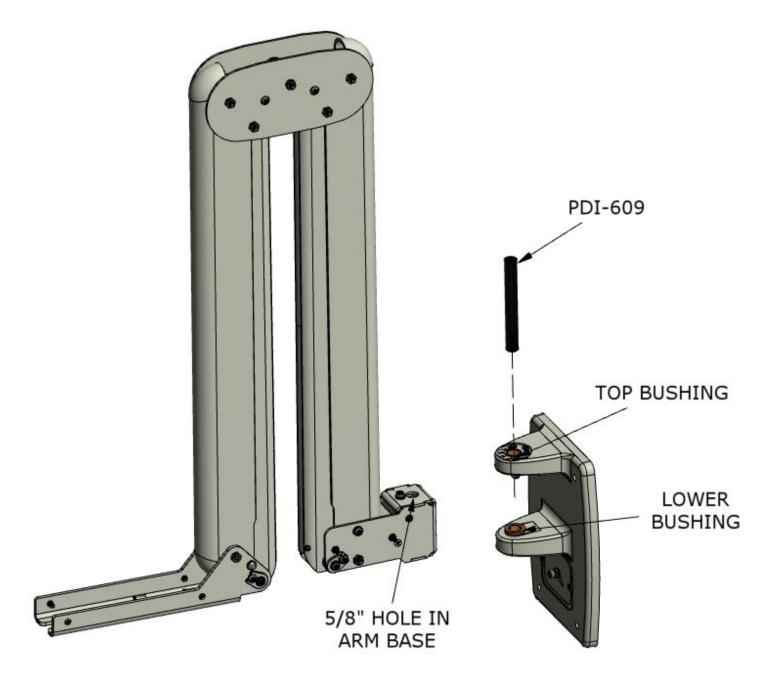



NODEL NOMBEN.		
PDI-AA1007	Series	Arm

Installation Instruction for 1007 Series Arm


Page 4 of 10

Step 3:

Make sure that the base pin is not sticking above the flat seat surface for the PD216-006 base pin cover.

IF THE BASE PIN IS NOT PROPERLY INSTALLED, IT CAN POSSIBLY LEAD TO FUTURE FAILURE OF THE ASSEMBLY!

Carefully rotate arm to verify there is not interference thru the horizontal range of travel. Proceed to the next step and install the **OPTIONAL** rotational stop screws, if they are desired. If the rotational stops are not needed, proceed to the step for installing the PD216-006 base pin cover.

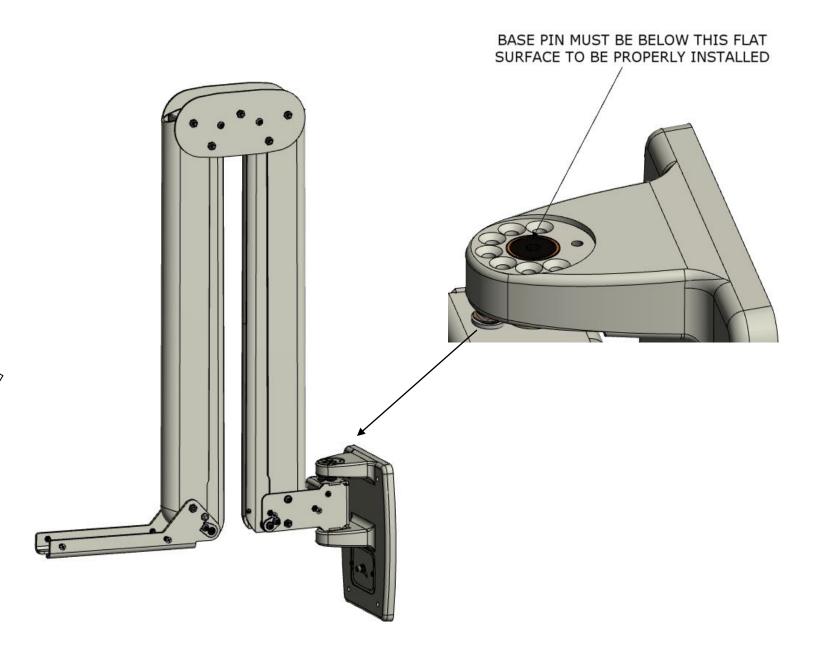



MODEL NUMBER:		
PDI-AA1007	Series	Arm

Installation Instruction for 1007 Series Arm

Page 5 of 10

Step 4: Optional Feature:

Install the rotational stop screws only if they are desired.


Rotate the arm to the desired rotating limit position.


Locate the best hole position to install the PDIPFHMS1032100 screw and PDINILN1032 lock nut.

Install the screw and nut as pictured and securely tighten. Make sure that the base pin and screw head are not sticking above the flat seat surface for the PD216-006 base pin cover.

Carefully rotate arm against stop to verify travel limit is correct.


(2) PDIPFMS1032100 screws and (2) PDINILN1032 lock nuts are provided to allow a rotational stop for both left and right rotation of the arm.

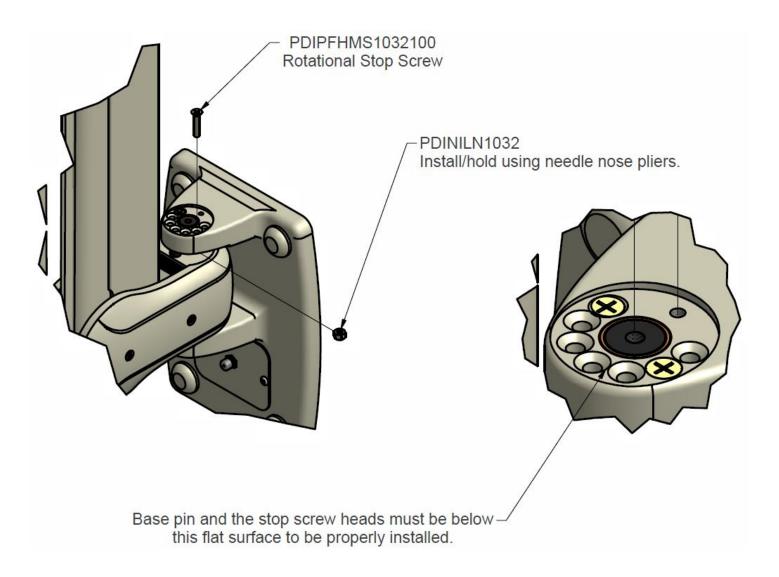



Step 5:

Re-install the PD216-006 base pin cover and secure with the PDIPFHMS103238 screw that was removed during STEP 1. Move the arm from side to side to verify that the arm moves freely.

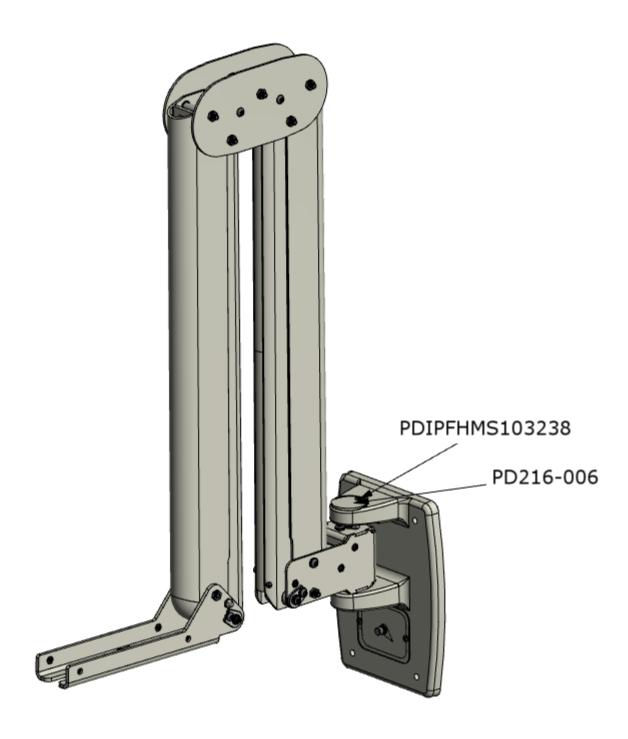



MODEL NUMBER:		
PDI-AA1007	Series	Arm


Installation Instruction for 1007 Series Arm

Page 7 of 10

Step 6:

Attach the TV to the nose of the arm as pictured below, using a PDISHCS252075 socket head cap screw. Make the coaxial cable connection per the installation documents supplied with the LCD TV.

After verifying that the LCD TV is correctly connected and functioning properly, begin installing the arm cover kit, Step 7.

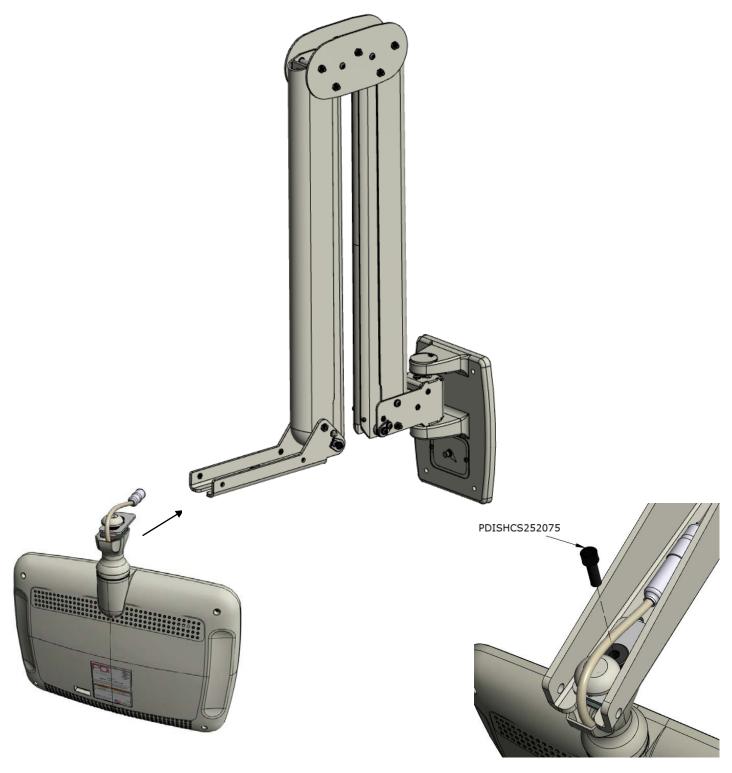

PDi	MODEL NUMBER: PDI-AA1007 Series Arm	Document Number: PD196-246R1
Communication Systems, Inc Better Solutions Are Within Reach®	Installation Instruction for 1007 Series Arm	Page 8 of 10

- 1) Attach arm to wall bracket and mount TV to arm before beginning cover installation.
- 2) Arm Safety Brake Pin must be removed from arm nose to install the new Nose Arm Cover.
- 3) DO NOT DISCARD SAFETY BRAKE PIN. Store the safety pin under one of the extra clamps in the nose of the arm, for future service of the arm and/or TV.

Snap the (3) PD216-001 End Caps into the ends of the arm sections as pictured. There should be two in the front section and one in the back section.

Step 8.

Attach the Base Cover halves PD216-002 using (2) PD209-004 screws each.

Step 9.

Securely snap the Elbow Covers PD216-003 around the elbow joint. Hook over the top edges of the elbow plates then snap the lower hooks along the bottom edges.

When the halves are properly installed there should only be a thin seam visible where the halves meet.


Step 10.

Attach the left and right Nose covers PD216-009L, PD216-009R to the nose using (4) PD209-004 screws as pictured.

When the halves are properly installed there should only be a thin seam visible where the halves meet.

Rotate the TV and move the arm thru its range of travel to check for any inference issues.

PARTS LIST for KIT:

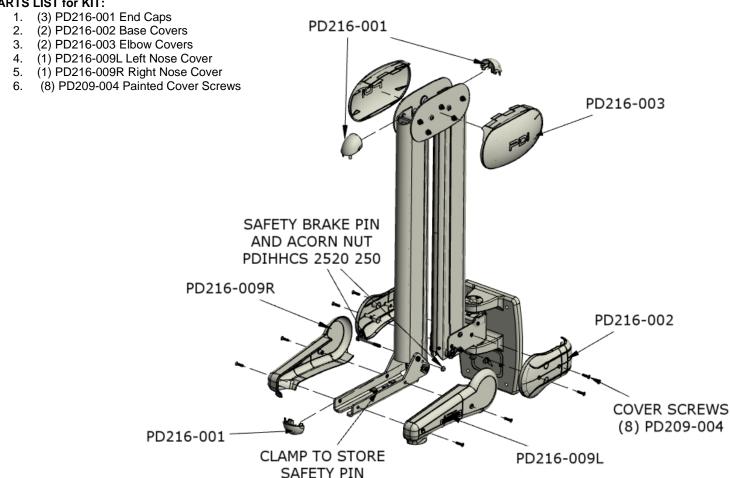

TV is not shown for installation clarity.




MODEL NUMBER:		
PDI-AA1007	Series	Arm

Installation Instruction for 1007 Series Arm

Document Number: PD196-246R1

Page 9 of 10

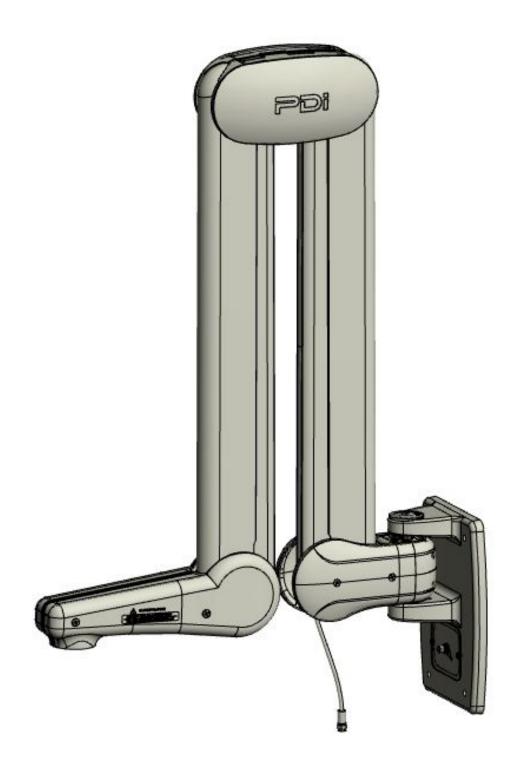

VIEW OF COVER KIT INSTALLED



MODEL NUMBER:

PDI-AA1007 Series Arm

Installation Instruction for 1007 Series Arm

Document Number: PD196-246R1

Page 10 of 10

ARM MAINTENANCE

Very little maintenance should be required for your PDI Arm to give years of trouble free service if the following lubrication and inspection procedures are followed.

- 1. INSPECTION Occasionally check the base pin for any evidence of bending or distortion due to a patient using the ARM for assistance in getting in or out of bed or any other misuse. If the ARM is not mounted with the base pin absolutely vertical, it will have a tendency to drift and will not properly counter balance the television. Be certain that the wall the arm is mounted to is vertical.
- 2. SPRING ADJUSTMENT The gas spring in this arm supports a specific weight range for the model construction. These springs are not "adjustable". The pivot points for some arm models can be moved to alter the weight capacity. Please contact the manufacturer for details. Otherwise the gas springs will have to be changed to alter the weight capacity of the arm.
- 3. LUBRICATION At least once a year a drop of light machine oil should be put on each pivot point in the nose, elbow, and base. DO NOT PUT OIL ON THE FRICTION DAMPER PADS!
- 4. REPLACEMENT OF COAX CABLE See cable replacement procedure in the full maintenance manual for your arm.
- 5. TORQUE ADJUSTMENT OF PIVOT SCREWS -All screws in the ARM are tightened securely, and Loctite, at the factory and do not require specific checks with a torque wrench. IF THE THREADS ARE STRIPPED IN THE NOSE, ELBOW, OR BASE, THAT PART NEEDS REPLACEMENT -DISCONTINUE USE IMMEDIATELY.

